

National Inspection Services

Report: 284858 03/19/2025

VIN: 5KKPAEFG8KPKS6664 Stock #: 15192

Commercial Credit Group, Inc (Mark Wenzel) 525 N Tryon Street, Charlotte, NC 28202 USA (704) 414-2456

2019 WESTERN STAR 4900

	SPECIFICATIONS
MILEAGE	173,244
ENGINE HOURS	8,358
ENGINE	CUMMINS X15 14.9L 505 HP
ENG BRAKE	YES
FUEL / TANKS	DIESEL - 1 STEEL 100 GAL TOTAL
TRANSMISSION	EATON RTLO-16918B 18 SPD MANUAL
DRIVE OPTS	POWER STEERING, CRUISE
REAR END	MERITOR 4.30
AXLE TYPE	TRI - F 20,000 LB / R 57,000 LB
GVWR	77,000
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	311"
TIRE SIZE	F 425/65 22.5 / R 12R 22.5
WHEELS	F ALUMINUM / R ALUMINUM
AIR COND	YES, OPERATIONAL
INTERIOR COLOR	BLACK/TAN
RADIO	AM/FM / BLUETOOTH, OPERATIONAL
HIGH BACK SEATS	DUAL
PASSENGER SEAT	AIR RIDE
EXTERIOR COLOR	WHITE
BUMPER	CHROME
EXTERIOR OPTS	HEATED MIRRORS




BRAKES			
LEFT FRONT	RIGHT FRONT		
30	30		
LEFT REAR 1	RIGHT REAR 1		
COVERED	COVERED		
LEFT REAR 2	RIGHT REAR 2		
30	30		
LEFT REAR 3	RIGHT REAR 3		
COVERED	COVERED		


TIRES & WHEELS				
LEFT FRONT 18 / 32 BRIDGESTONE ALUMINUM		RIGHT FRONT 16/32 BRIDGESTONE ALUMINUM		
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1	
16 / 32 FIRESTONE ALUMINUM	19 / 32 FIRESTONE ALUMINUM	21 / 32 MICHELIN ALUMINUM	21 / 32 MICHELIN ALUMINUM	
LEFT OUTER 2	LEFT INNER 2	RIGHT INNER 2	RIGHT OUTER 2	
23 / 32 BRIDGESTONE ALUMINUM	22 / 32 BRIDGESTONE ALUMINUM	13 / 32 FIRESTONE ALUMINUM	16 / 32 FIRESTONE ALUMINUM	
LEFT OUTER 3	LEFT INNER 3	RIGHT INNER 3	RIGHT OUTER 3	
21 / 32 FIRESTONE ALUMINUM	18 / 32 FIRESTONE ALUMINUM	9 / 32 FIRESTONE ALUMINUM	17 / 32 FIRESTONE ALUMINUM	
FRONT TIRES : 425/65 22.5		REAR TIRES: 12R 22.5		

		GENERAL OF	GENERAL OBSERVATIONS	
OIL MILKY?	NO		LIGHTS WOR	
OIL WILK 1:	NO		LIGITIS WOR	
OIL LEAKS?	NO		WIPERS WOR	
WATER LEAKS?	NO		GAUGES WO	
OIL IN COOLANT?	NO		AIR HORN WO	
CLUTCH PLAY?	OK		CITY HORN W	
STARTS?	YES			

DRIVES	TES		DIESEL PARTICULATE FILTER	PASS
WEAR & TEAR DETAIL				
DIAGNOSTICS		NO ACTIVE WARNING INDICATORS		
TANKS		HAS MULTIPLE RUST SPOTS ON BOTH SIDES		
BUMPER		BOTH SIDES ARE BENT		



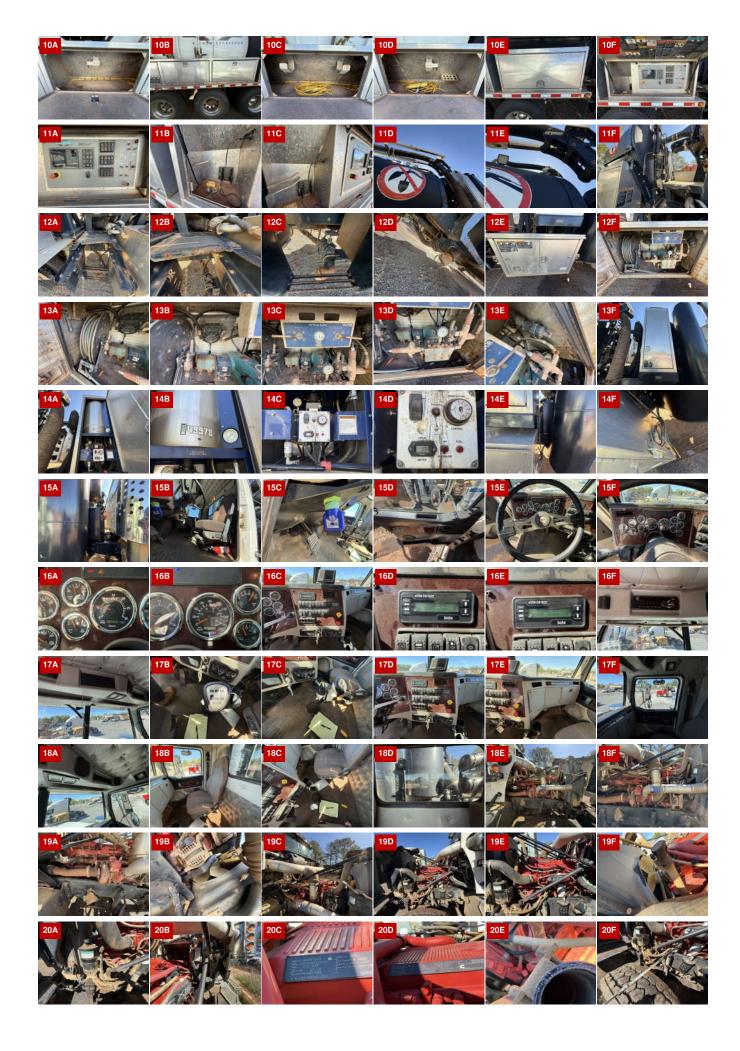

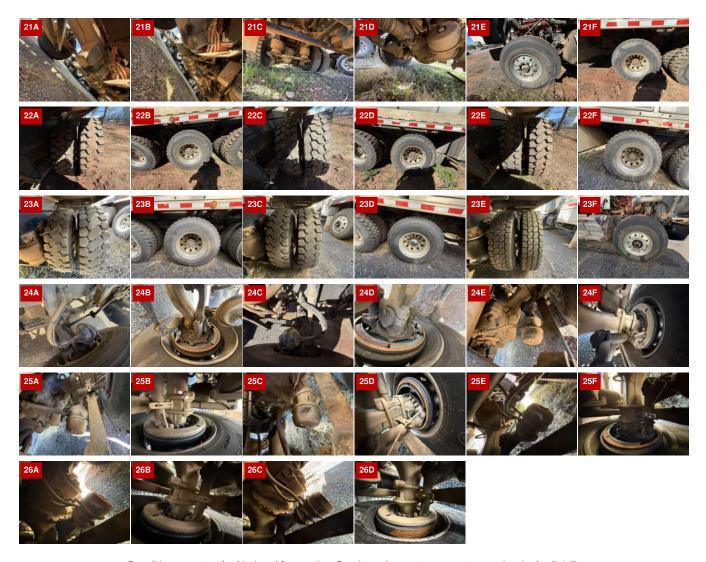

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services 101 W. Shrader St. Liberty, MO 64068 www.nationalinspect.com